

Drawing



Hendi B.V.
Steenoven 21
3911 TX Rhenen
The Netherlands

Batch #

193922 and up
From 02/2021

Appliance part#

232149

Description


Freezer 1300L ProfiLine

Date 03-11-2021

Revision #

1.3

Revision New controller, new door detection switch.

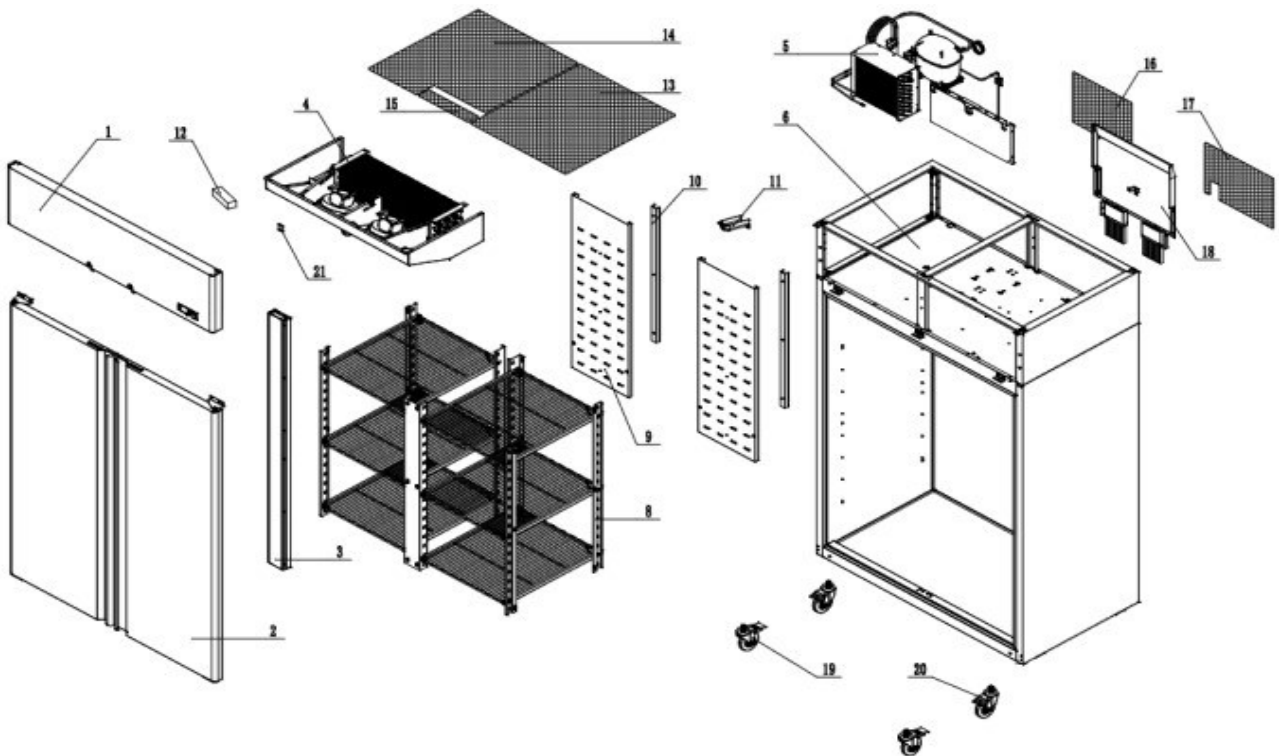

Bill of materials (BOM)

 Hendi B.V. Steenoven 21 3911 TX Rhenen The Netherlands	Batch #	Appliance part#
	193922 and up From 02/2021	232149
	Description	
	Freezer 1300L ProfiLine	

Date	03-11-2021	Revision #	1.3
Revision	New controller, new door detection switch.		

Item	Description	Part#	Quantity	Remark	Picture
1	Front panel assembly	n/a	1	See drawing 2 and Bom 2	
2	Door assembly	n/a	1	See drawing 3 and Bom 3	
3	Divider bar assembly	n/a	1	See drawing 6 and Bom 6	
4	Evaporator assembly	n/a	1	See drawing 4 and Bom 4	
5	Compressor/condenser assembly	n/a	1	See drawing 5 and Bom 5	
6	Cabinet assembly	n/a	1	See drawing 6 and Bom 6	
8	Shelf assembly	n/a	1	See drawing 7 and Bom 7	
9	Deflector	n/a	1		
10	Deflector bracket	n/a	1		
11	Drain protector	n/a	1		
12	LED driver	957974	1		
13	Wire frame (top-right)	n/a	1		
14	Wire frame (top-left)	n/a	1		
15	Wire frame (top-middle)	n/a	1		
16	Wire frame (back-right)	n/a	1		
17	Wire frame (back-left)	n/a	1		
18	Drain pan cover	n/a	1		
19	Swivel wheel with brake	944707	2		
20	Swivel wheel without brake	944714	2		
21	LED controller	n/a	1		

n/a -> not available

nss -> not sold separately

Drawing



Tools for Chefs

Hendi B.V.

Steenoven 21
3911 TX Rhenen
The Netherlands

Batch #

193922 and up
From 02/2021

Appliance part#

232149

Description


Freezer 1300L ProfiLine

Date 03-11-2021

Revision #

1.3

Revision New controller, new door detection switch.

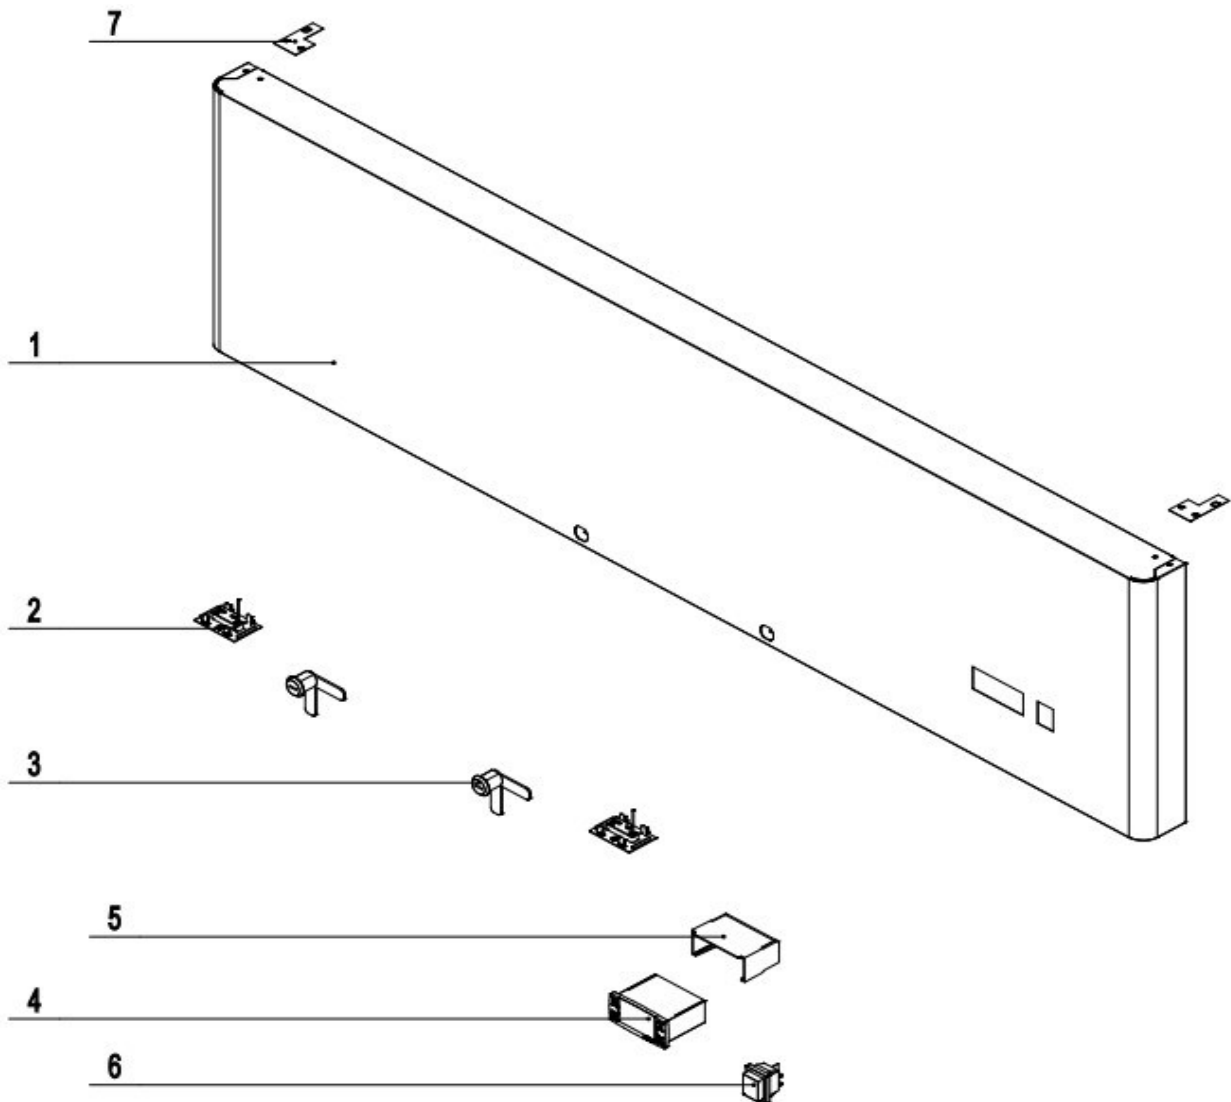

HENDI Tools for Chefs Hendi B.V. Steenoven 21 3911 TX Rhenen The Netherlands	Batch #	Appliance part#
	193922 and up From 02/2021	232149
	Description	
	Freezer 1300L ProfiLine	

Item	Description	Part#	Quantity	Remark	Picture
1	Front apnel (top)	n/a	1		
2	Door detection switch	960554	2		
3	Lock	n/a	2		
4	Digital controller	956267	1		
5	Controller cover	n/a	1		
6	Switch	205426	1		
7	Bracket	n/a	2		

nss **-> not sold separately**

Drawing



Tools for Chefs

Hendi B.V.

Steenoven 21
3911 TX Rhenen
The Netherlands

Batch #

193922 and up
From 02/2021

Appliance part#

232149

Description


Freezer 1300L ProfiLine

Date 03-11-2021

Revision #

1.3

Revision New controller, new door detection switch.

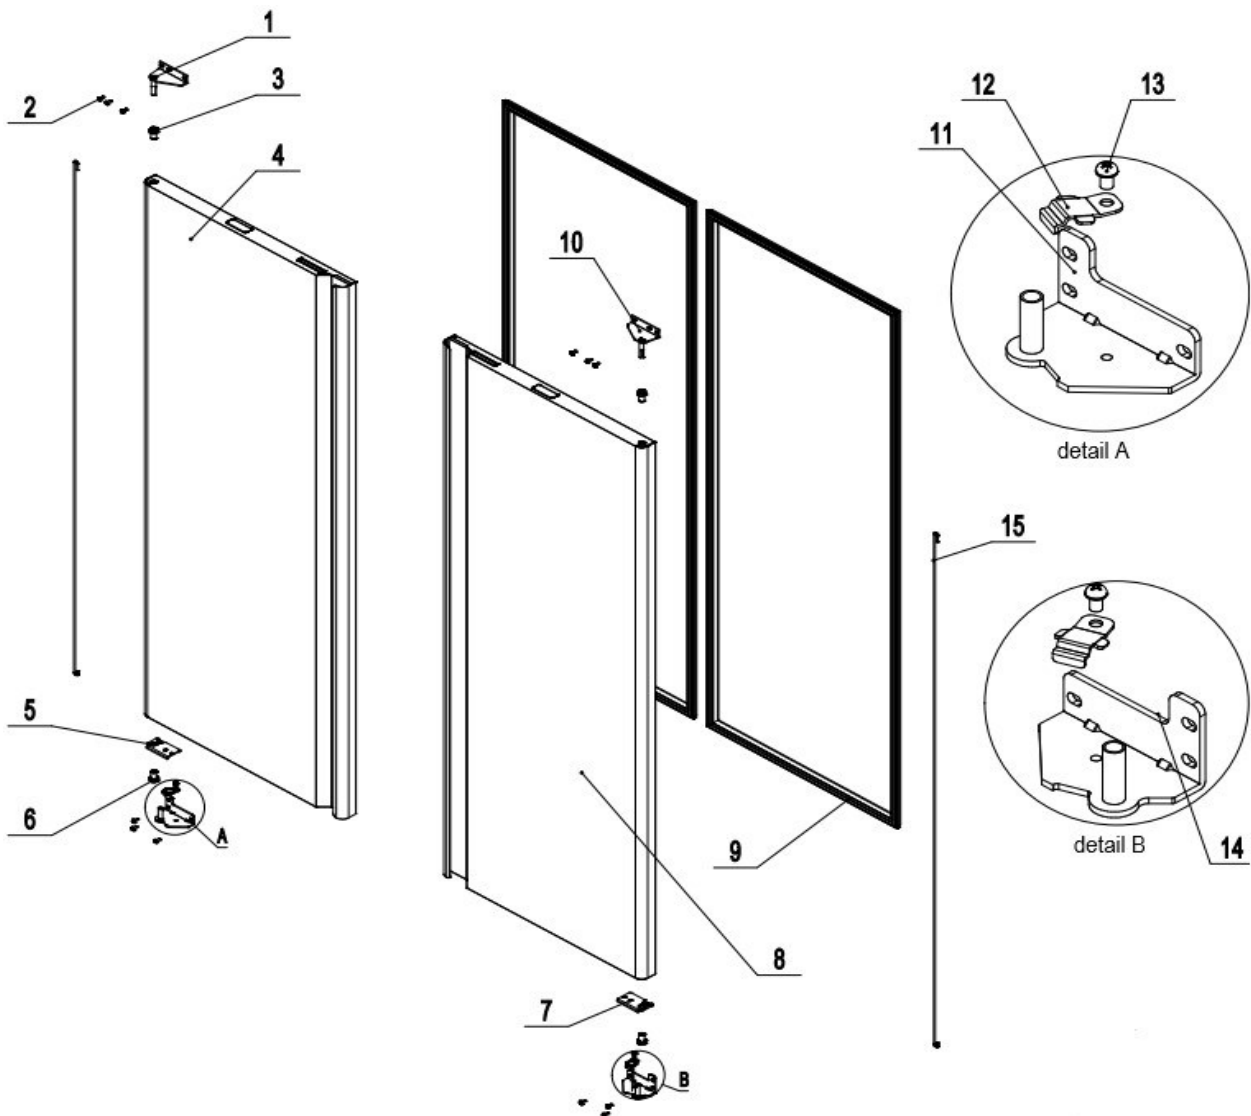

HENDI Tools for Chefs Hendi B.V. Steenoven 21 3911 TX Rhenen The Netherlands	Batch #	Appliance part#
	193922 and up From 02/2021	232149
	Description	
	Freezer 1300L ProfiLine	

Item	Description	Part#	Quantity	Remark	Picture
1	Hinge (top-left)	948347	1		
2	Screw (M5x12)	n/a	12		
3	Hinge sleeve (top)	n/a	2		
4	Door (left)	n/a	1		
5	Door brake (left)	n/a	1		
6	Hinge sleeve (bottom)	n/a	2		
7	Door brake (right)	n/a	1		
8	Door (right)	n/a	1		
9	Door gasket (1565x680mm)	945704	2		
10	Hinge (top-right)	948354	1		
11	Hinge (bottom-left)	948378	1		
12	Door brake (bottom)	n/a	1		
13	Screw (M6x8)	n/a	2		
14	Hinge (bottom-right)	948361	1		
15	Door spring	n/a	1		

Page 6 van 17

Drawing



Tools for Chefs

Hendi B.V.

Steenoven 21
3911 TX Rhenen
The Netherlands

Batch #

193922 and up
From 02/2021

Appliance part#

232149

Description


Dreezer 1300L ProfiLine

Date 03-11-2021

Revision #

1.3

Revision New controller, new door detection switch.

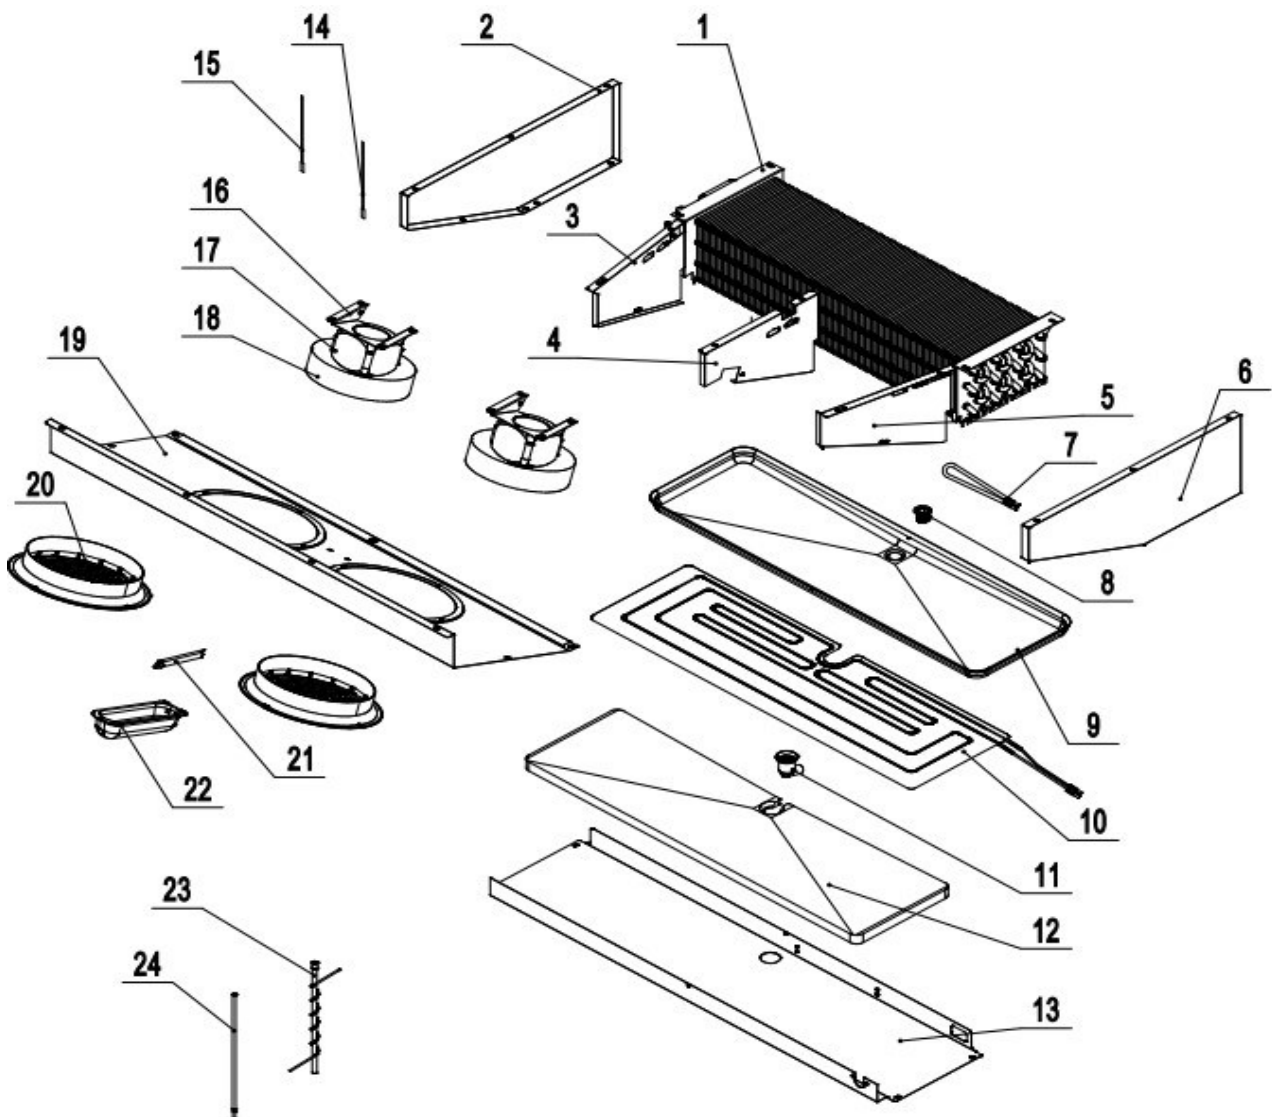

Bill of materials (BOM)

 HENDI Tools for Chefs Hendi B.V. Steenoven 21 3911 TX Rhenen The Netherlands	Batch #		Appliance part#
	193922 and up From 02/2021		232149
	Description		
	Freezer 1300L ProfiLine		

Date	03-11-2021	Revision #	1.3
Revision	New controller, new door detection switch.		

Item	Description	Part#	Quantity	Remark	Picture
1	Evaporator	958179	1		
2	Evaporator cover (left)	n/a	1		
3	Airflow bracket (left)	n/a	1		
4	Airflow bracket (middle)	n/a	1		
5	Airflow bracket (right)	n/a	1		
6	Evaporator cover (right)	n/a	1		
7	Drain hose heater	958094	1		
8	Drain hose connector B	nss	1		
9	Evaporator drain pan	958193	1	Incl. item 8,10,11,12 and 13	
10	Drain pan heater	nss	1		
11	Drain hose connector A	nss	1		
12	Drain pan insulation	nss	1		
13	Drain pan cover	nss	1		
14	Room temperature probe	958018	1		
15	Evaporator temperature probe	958025	1		
16	Evaporator fan bracket	n/a	1		
17	Evaporator fan motor	958001	1		
18	Evaporator fan blade	n/a	1		
19	Evaporator cover (front)	n/a	1		
20	Evaporator fan cover	n/a	1		
21	LED light	958032	1		
22	LED light cover	958056	1		
23	Coolant pipe	n/a	1		
24	Defrost pipe	n/a	1		


n/a -> not available

nss -> not sold separately

Drawing

 HENDI Tools for Chefs Hendi B.V. Steenoven 21 3911 TX Rhenen The Netherlands	Batch #	Appliance part#
	193922 and up From 02/2021	232149
	Description	
	Freezer 1300L ProfiLine	

Date	03-11-2021	Revision #	1.3
Revision	New controller, new door detection switch.		

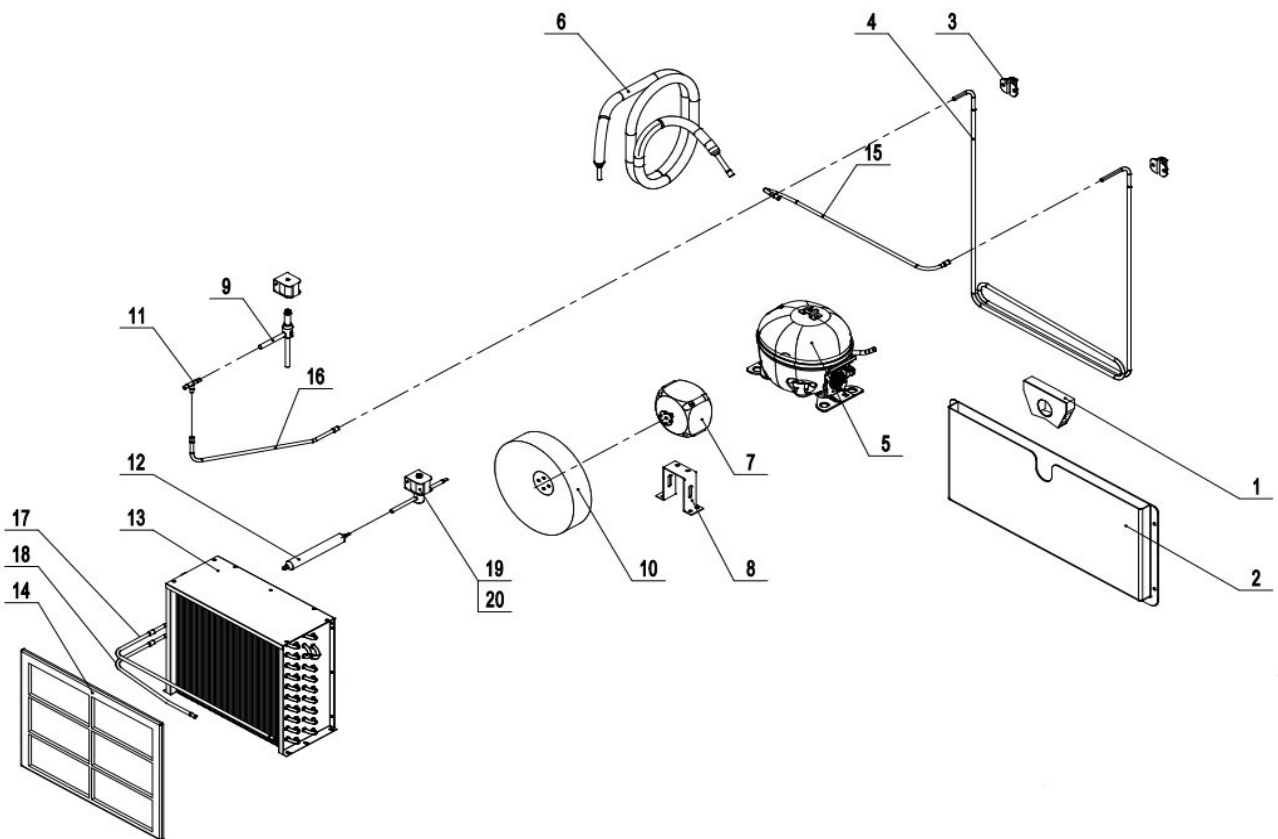

Bill of materials (BOM)

 Hendi B.V. Steenoven 21 3911 TX Rhenen The Netherlands	Batch #		Appliance part#
	193922 and up From 02/2021		232149
	Description		
	Freezer 1300L ProfiLine		

Date	03-11-2021	Revision #	1.3
Revision	New controller, new door detection switch.		

Item	Description	Part#	Quantity	Remark	Picture
1	Drain box balancer	n/a	1		
2	Drain box	975138	1		
3	Condenser coil bracket	n/a	2		
4	Condenser coil	n/a	1		
5	Compressor	n/a	1		
6	Condenser return coil	n/a	1		
7	Condenser fan	958070	1		
8	Condenser fan bracket	n/a	1		
9	Solenoid valve	958186	1	(normally closed)	
10	Condenser fan blade	n/a	1		
11	Coolant pipe "T"	n/a	1		
12	Dryer filter	n/a	1		
13	Condenser	n/a	1		
14	Condenser filter	n/a	1		
15	Coolant pipe (suply)	n/a	1		
16	Coolant pipe (drain)	n/a	1		
17	Condenser coolant pipe (suply)	n/a	1		
18	Condenser coolant pipe (drain)	n/a	1		
19	Solenoid valve coil	nss	2		
20	Solenoid valve	n/a	1	(normally open)	

n/a -> not available

nss -> not sold separately

Drawing



Tools for Chefs

Hendi B.V.

Steenoven 21
3911 TX Rhenen
The Netherlands

Batch #

193922 and up
From 02/2021

Appliance part#

232149

Description

Freezer 1300L ProfiLine

Date


03-11-2021

Revision #

1.3

Revision

New controller, new door detection switch.

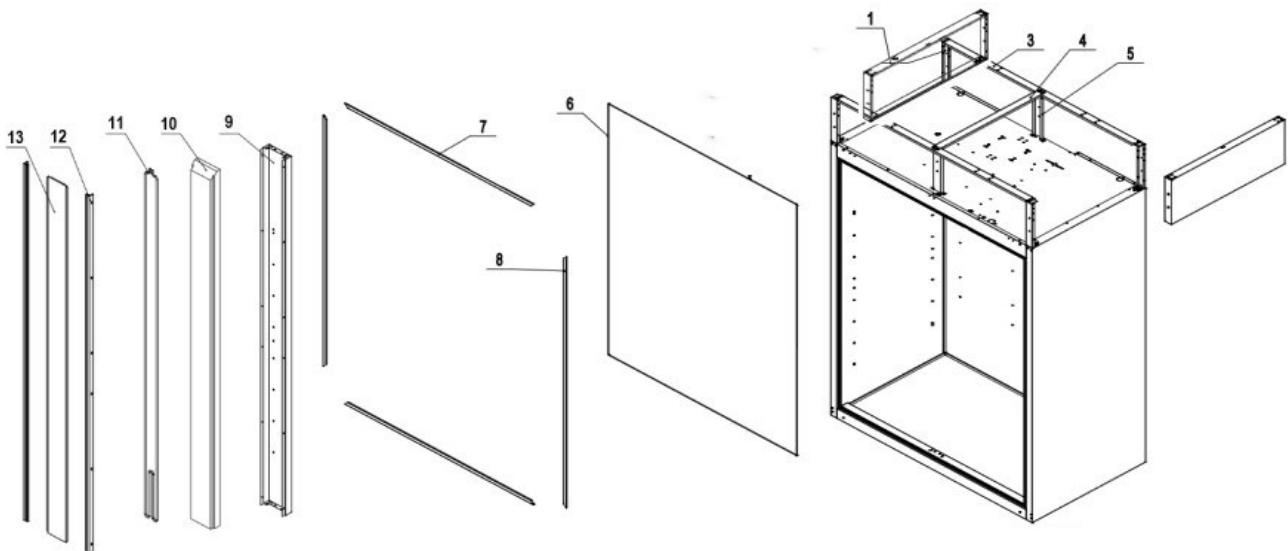

Bill of materials (BOM)

 HENDI Tools for Chefs Hendi B.V. Steenoven 21 3911 TX Rhenen The Netherlands	Batch #	Appliance part#
	193922 and up From 02/2021	232149
	Description	
	Freezer 1300L ProfiLine	

Date	03-11-2021	Revision #	1.3
Revision	New controller, new door detection switch.		

Item	Description	Part#	Quantity	Remark	Picture
1	Side panel	n/a	2		
2	Side panel bracket	n/a	4		
3	Top bracekt (long)	n/a	2		
4	Top bracket (short)	n/a	1		
5	Top bracket support	n/a	1		
6	Cabinet heater pipe	n/a	1		
7	Cabinet cover (top/bottom)	n/a	2		
8	Cabinet cover (left/right)	n/a	2		
9	Cabinet divider bar (back)	n/a	1		
10	Cabinet divider insulation	n/a	1		
11	Cabinet divider defrost pipe	n/a	1		
12	Cabinet divider cover	n/a	2		
13	Cabinet divider bar (front)	n/a	1		


n/a -> not available

nss -> not sold separately

Drawing

 HENDI Tools for Chefs Hendi B.V. Steenoven 21 3911 TX Rhenen The Netherlands	Batch #	Appliance part#
	193922 and up From 02/2021	232149
	Description	
	Freezer 1300L ProfiLine	

Date	03-11-2021	Revision #	1.3
Revision	New controller, new door detection switch.		

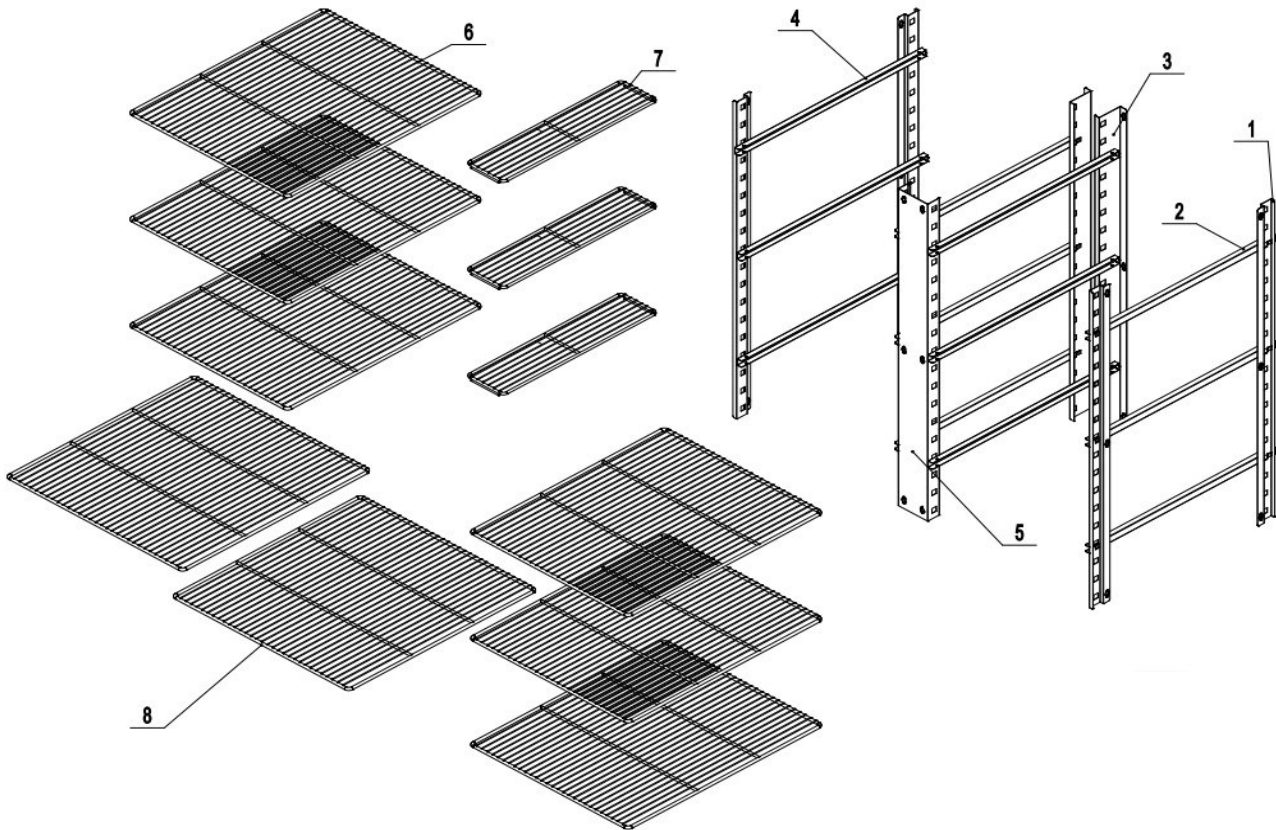

Bill of materials (BOM)

 HENDI Tools for Chefs Hendi B.V. Steenoven 21 3911 TX Rhenen The Netherlands	Batch #	Appliance part#
	193922 and up From 02/2021	232149
	Description	
	Freezer 1300L ProfiLine	

Date	03-11-2021	Revision #	1.3
Revision	New controller, new door detection switch.		

Item	Description	Part#	Quantity	Remark	Picture
1	Shelf holder bracket (sides)	n/a	4		
2	Shelf holder (right)	nss	6	Available as 936207	
3	Shelf holder bracket (middle-back)	n/a	2		
4	Shelf holder (left)	936207	6	Incl. item 2	
5	Shelf holder bracket (middle-front)	n/a	1		
6	Shelf	936191	6		
7	Shelf (center)	n/a	3		
8	Shelf (bottom)	n/a	2		

n/a -> not available

nss -> not sold separately

Drawing



Tools for Chefs

Hendi B.V.

Steenoven 21
3911 TX Rhenen
The Netherlands

Batch #

193922 and up
From 02/2021

Appliance part#

232149

Description


Freezer 1300L ProfiLine

Date 03-11-2021

Revision #

1.3

Revision New controller, new door detection switch.

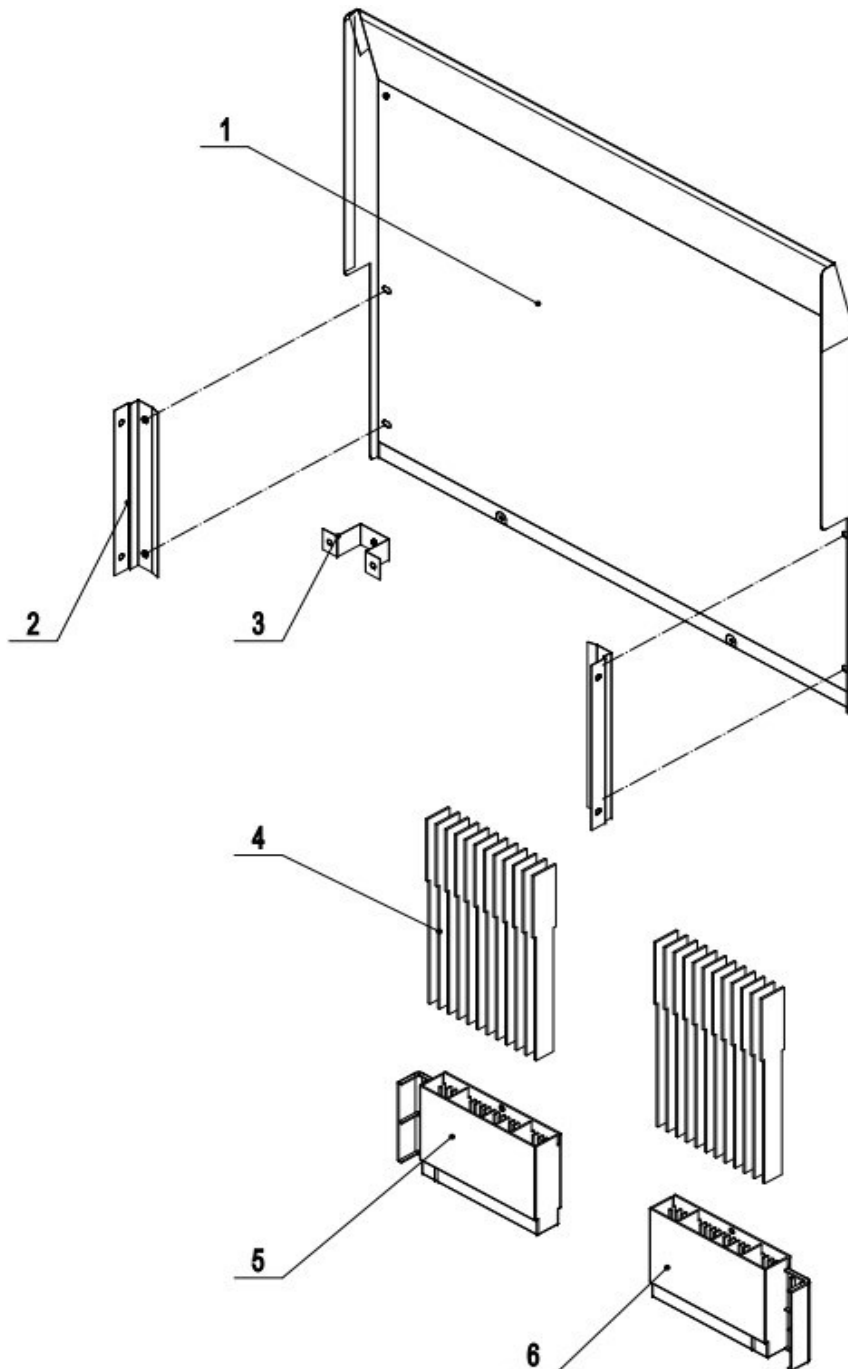

HENDI Tools for Chefs Hendi B.V. Steenoven 21 3911 TX Rhenen The Netherlands	Batch #	Appliance part#
	193922 and up From 02/2021	232149
	Description	
	Freezer 1300L ProfiLine	

Item	Description	Part#	Quantity	Remark	Picture
1	Cover	n/a	1		
2	Bracket (side)	n/a	2		
3	Bracket (middle)	n/a	1		
4	Aborbent paper	nss	2		
5	Aborption unit (right side)	958117	1		
6	Aborption unit (left side)	958100	1		

nss	-> not sold separately
-----	------------------------

Circuit diagram



HENDI

Tools for Chefs

Hendi B.V.

Steenoven 21
3911 TX Rhenen
The Netherlands

Batch #

193922 and up
From 02/2021

Appliance part#

232149

Description

Freezer 1300L ProfiLine

Date 03-11-2021

Revision #

1.3

Revision

New controller, new door detection switch.

